


TEMPERATURE

Pt100 sensor with handle, type FPA106LxxxxH

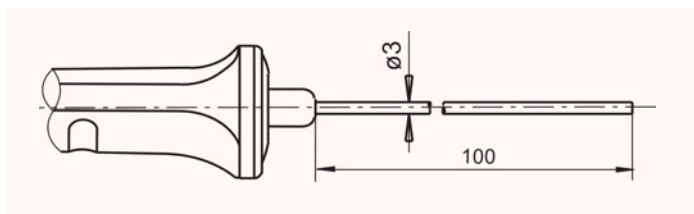


For immersion measurement

Meas. element: Pt100, class B *
 Measuring tip: Operative range -70...+500 °C
 Sheath element, Inconel
 T₉₀: * 8 s
 Handle: * 127 mm
 Cable: 1.5 m Teflon/Silicone

L = 100 mm **Order no FPA106L0100H**

Pt100 sensor with handle, type FPA123LxxxxH

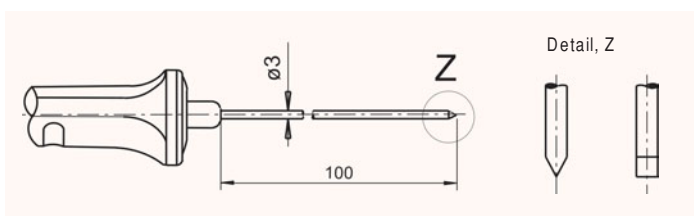


For immersion measurement in plastic and pasty substances

Meas. element: Pt100, class B *
 Measuring tip: Operative range -70...+500 °C
 Penetrating tip
 T₉₀: * 8 s
 Handle: * 127 mm
 Cable: 1.5 m Teflon / silicone

L = 100 mm **Order no FPA123L0100H**

Pt100 sensor with handle, type FPA124LxxxxH

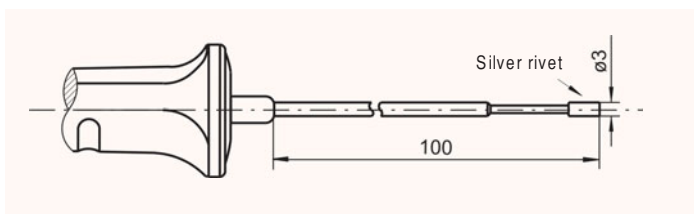


For surface measurement and immersion measurement

Meas. element: Pt100, class B *
 Measuring tip: Operative range -50...+300 °C
 Silver rivet, level
 T₉₀: * 10 s
 Handle: * 127 mm
 Cable: 1.5 m Teflon / silicone

L = 100 mm **Order no FPA124L0100H**

Pt100 sensor with handle, type FPA420LxxxxH

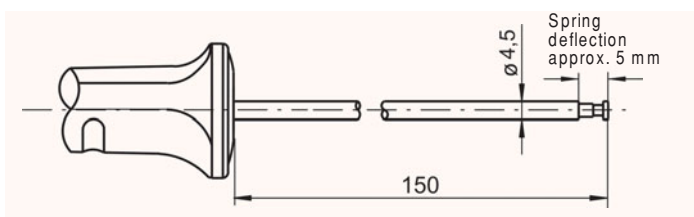

For surface measurement on level, metallic surfaces

Meas. element: Pt100, class B *
 Measuring tip: Operative range -50...+400 °C
 Ceramic, spring-loaded
 T₉₀: * 10 s
 Handle: * 127 mm
 Cable: 1.5 m PVC

L = 150 mm **Order no FPA420L0150H**